

# Broads Authority

## Cultural Heritage Survey Sheet

### Stokesby with Herringby, Old Hall Mill & Cottage.



<b>Cultural Heritage ID No:</b> - None	<b>Inspection date(s):</b> - Ben Hogg & Prue Smith 12/08/08 & 21/10/08	<b>Location, Address and Grid Ref:</b> -	
<b>Listed Grade:</b> - (N/L, N/PL) N/L	<b>Fragility:</b> - (1 – 3)	<b>Mill 1 Cottage 1</b>	<b>Vulnerability:</b> - <b>Mill 1 Cottage 1</b> (1 – 3)
<b>Photographs:</b> - Mill - IMG 0563 – 4, 0937 – 40. Cottage IMG 0941 - 43		<b>BAR Risk Grade:</b> - (A – F)	<b>A</b>
List description / Context: - <b>Mill</b> - Small 19c? tarred brick tower mill. No cap, joinery or machinery. Accessible beside river bank. <b>Cottage</b> - 2 storey 19c redbrick, evidence of thatched roof.			
<b>Comments:</b> -. Remains of first floor construction evident internally, unusual floor/supports at 2 <sup>nd</sup> floor level? No obvious cracking in b/w and openings and arches seem stable. B/w spalling internally. Severe ivy growth to west of tower and signs of vandalism.  Mill Cottage – in very poor condition – all joinery & thatch missing, rafters and floor joists exposed and collapsing. B/w collapsing due to vandalism which is also evident internally.  NB. 12/08/08 - both inspected from river, cottage barely visible. 21/10/08 - Inspected on foot.			
<b>Threat posed:</b> - <b>Mill</b> - Ivy growth and vandalism, water damage to brickwork. <b>Cottage</b> – Roof and floor timbers exposed to elements, vandalism.			
<b>Conclusion / Recommendation:</b> - <b>Immediate:</b> <ul style="list-style-type: none"> <li>• <b>Mill</b> – secure, temporary cap, block openings, remove ivy.</li> <li>• <b>Cottage</b> – Secure, block openings, remove ivy, temporary roof covering.</li> </ul> <b>Medium/long term</b> <ul style="list-style-type: none"> <li>• Consider future ownership/use and repairs</li> </ul>			